

Application of Multi Temporal Satellite Data for the study of Water Resource problems in Udaipur Basin, South Rajasthan, India

Dr. Narpat Singh Rathore
Associate Professor
Department of Geography
University College of Social Science and Humanities,
M.L.Sukhadia University
Udaipur – 313 001 Rajasthan, India
Phone: +91 294 2426548
E-mail: rathorens@yahoo.com

ABSTRACT: Udaipur City, the city of lakes is facing an acute problem of the drying of its lakes. These lakes for the past 500 years have been the principal lifelines of the Udaipur basin. Their drying up has caused a severe set back to the tourism industry and other economic activities in the region. Many causes are responsible for it. Some these include erratic rainfall, explosive population growth, encroachment of lake- beds and rapid urbanization. Measures need to be taken to save these lakes through water conservation techniques, construction of new link channels etc. Remotely sensed data provides a effective tool for the analysis of the problem.

KEYWORDS: Catchment area, Basin, Lakes, Landsat, LISS I, LISS III & LISS IV, Lineament, Population

STUDY AREA

The study area Udaipur Basin lies between $73^{\circ}36'51''$ East to $73^{\circ}49'46''$ E longitude and $24^{\circ}28'49''$ to $24^{\circ}42'56''$ North latitude (Fig-1). It is a saucer shaped basin 22 kms wide from East to West and 24 kms long from North to South. It is wider in the South and tapers northwards. Its average height is 577 meters above the mean sea level. The tropic of cancer lies 122 kms to the South of the study area. Udaipur City popularly known, as the city of Lakes or Venice of the East is a picturesque city located to the south of the North-Western state of Rajasthan in India. Founded by Maharana Udai Singh of Mewar in 1559 A.D. Udaipur is one of the most majestic and historical city with rich cultural heritage and diversity.

PROBLEM UNDER STUDY

Udaipur Basin is the recent years, (past six years since 1999) has been facing an acute problem of drought. There is a severe water crisis. Both the surface and underground water sources have depleted considerably. The lakes have completely dried up causing a severe set back to the tourism, agriculture and other economic activities. The present paper is an attempt to make an in-depth study of the underlying causes of this critical situation and make constructive suggestions for future. Remotely Sensed data has been used for making this study.

MATERIALS AND METHODS

The present study has been undertaken with the help of Survey of India Toposheets of scale 1:25000 and 1:50000 surveyed in 1959-60, 1967-72 and 1973 respectively. Satellite images of varying resolutions for

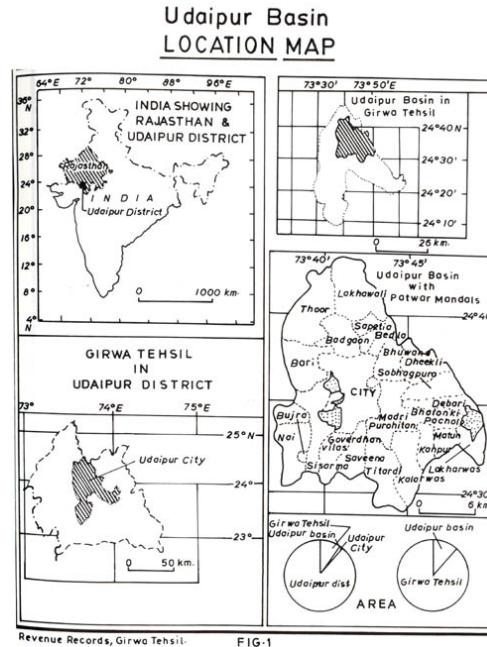


FIG-1

different years viz. Land sat MSS data of 3rd March, 1975 with 80 meters resolution, IRS data of LISS I of 18th February, 1996 with 72.5 meters resolution, IRS data of LISS III of 8th February 2004 with 23.5 meters resolution and IRS data of LISS-IV of 7th June, 2004 with 5.6 meters resolution have been used. Besides this Geological Survey of India Map 1997 depicting lithological formation of the region has also been used. Ground truths have been verified through field survey. Secondary data pertaining to rainfall, irrigation, land use, population, lake water storage capacity, forest cover etc. have also been acquired from various Govt. institutions and Department of Geography U.C.S.S.H., M.L.Sukhadia University, Udaipur.

For this study three broad methods have been used. Visual interpretation of Remotely Sensed data, mathematical analysis and field survey for verification of ground truth. The satellite data have been geo referenced. Digital Imaging Processing Techniques have been used for the demarcation of cropped area for 1975, 1996 and 2004. Catchment boundaries have been overlaid. Geological Map has been referred for lithological composition of the entire basin and a composite picture has been arrived at for analysis including lineaments, drainage, settlements and roads.

PHYSIOGRAPHY, GEOLOGY, DRAINAGE AND CLIMATE

A brief insight into the physiography, geology, drainage and climatic conditions of the study area would not be out of place for an objective analysis of the problem. Structurally Udaipur basin is a saucer shaped basin in form of a deep valley surrounded by the Aravalli hill ranges which girdle it from all sides. Locally it is called Girwa meaning a range of hills (Fig-2)

Udaipur basin is largely dominated by Aravalli and post Aravalli geological systems with phyllite and schist as dominant rock types. The main city area lies on soft and cleaved metamorphic rocks of phyllite, schist and metagraywacke. The rocks of upper catchment area are composed of phyllite, schist, basic volcanics, and pyroclastics with enclaves of metaconglomerate and marble. Traces of limestone, lineaments and granite are found in the west along Sisarma River. The satellite image (IRS P6) of February 2004 depicts three prominent set of lineaments, trending NE-SW, NW-SE and EW directions around Udaipur City. These lineaments represent fracture zones in the area. The lineaments control the drainage and act as conducts for water seepage/ recharge of the lacs in the basin. These are however no faults and folds in the Udaipur lake region to cause any underground seepage from the lakes.

The region is drained by river Ahar and its tributaries. This is the only major river that flows through this region. It originates from the hills of Gogunda lying in the North West of Udaipur City, flows for a distance of 30 kms and joins Udaisagar in the East. It is joined by numerous tributaries and subtributaries. Sisarma River with its tributaries Amarjok and Kotra is one such important tributary that merges into the Picchola Lake in Udaipur City. The Ahar River and its tributaries are seasonal in nature, they flow only during the rainy season and remain dry for the rest of the period. The basin is characterized by typical pinnate drainage pattern. Ahar River lies at the centre and its tributary form in dendritic pattern. India's principal water divide passes over 610 meters contour towards west of Udaipur City.

Climatically Udaipur basin is transitional between semi-arid region in the north and sub-humid region in the south. It receives an annual rainfall of 65 cms, bulk of it is received during the summer season from the South West monsoons. Winters are dry with mild temperature and occasional cold waves. The nature of rainfall in the basin is highly erratic and uncertain. There is high variability in the amount of rainfall received. Consequently occurrences of droughts coupled with rainfall are a characteristic feature of the basin.



FIG-2

Keeping in view the above climatic conditions and limited natural water resources the erstwhile rulers ‘Maharanas’ of Mewar constructed several lakes in the Udaipur basin to overcome the problems of availability of water for the local population. These lakes are the principal lifelines of the residents of the basin. The Udaipur Lake region is divided into six major catchments (Table-1)

Table-1 Udaipur Catchment of Lake Region (in Hectares)

Lake Region	Catchment Area
Bada Madar	8780.48
Chhota Madar	2987.23
Fatehsagar	4325.35
Bari Ka Talab	1906.55
Pichhola	14610.63
Goverdhan Sagar	814.63

Source : Based on Indian Topographical Maps & Satellite data, RRSSC, Jodhpur

A brief description of the major lakes is given below:

- (i) **Pichhola-** It is the oldest amongst all the city lakes. It was constructed 600 years ago between 1382 and 1392 by Rana Lakha. This lake is situated in the southwestern part of the city at $73^{\circ}40'E$ longitude and $24^{\circ}34'$ north latitude. It derives its name from the village of 'Pichholi'. It accounts for a total water body area around 6.96 sq. Kilometres and has gross, live and dead capacities of 483,318 and 165mcft. respectively. Its gauge height above and below sill level is 3.35 and 5.2 metres. The lake has a maximum depth of 10.5 metres.
- (ii) **Rang Sagar-** It was constructed in 1668. It is 1.03 kilometres long and 245 metres wide. It has a maximum depth of 7 metres. It acts as a link channel between Pichhola Lake towards south and Swaroop Sagar and Fateh Sagar in the north. It's water holding capacity is 1000 mcft.
- (iii) **Swaroop Sagar-** It is a pear shaped lake which was constructed in the year 1678. Its gross capacity is 427 mcft. Its live and dead capacity is 247 mcft and 180 mcft respectively. Its total area is 4.00 square kilometres and has a maximum depth of 13.4 metres.
- (iv) **Fatehsagar:** Lake Fatehsagar is another principal lake of the city. The Lake is situated at $24^{\circ}35'$ N. lat. and $73^{\circ}37'E$. Longitude at 578 metres altitude (m.s.l.) in the north western side of the city. This pear shaped and medium sized lake was constructed by Rana Jai Singh in 1678 A.D. It was renovated in 1889 A.D. by Maharana Fateh Singh. The lake is 720 metres long, about 100 metres wide and rises nearly 40 metres from the ground level towards east. Fatehsagar lake stretches 2.6 kms in north-south and 1.8 kms in east-west directions, covering a total water spread of nearly 4.00 sq.km. and maximum depth of 13.4 metres. It commands a total catchment area of about 41 sq.km. Its gross, live and dead capacity is 427.60, 247.60 and 180-mcft water, evidently lower than that of Pichhola.
- (v) **Goverdhan Sagar-** This lake is situated to the south of Pichhola at $74^{\circ}42'$ East longitude and $24^{\circ}34'$ North latitude. Its gross catchment area is 2.5 square kilometres and its live capacity is 9 mcft. It is connected with Lake Pichhola through a link channel.

DISCUSSION

Udaipur Basin is the past six years (from 1999-2004) had been facing the problem of drought. The average rainfall during these years has remained below normal to the extent of more than 30%. This has severely affected the availability of water in the basin. Both the surface water and underground water resources got depleted. The lakes became dry, large proportions of the basin have turned into a dark zone. Almost all the lakes, the lifelines of the basin bore a deserted look. Recurring droughts are not uncommon in the basin. However it is for the first time in the past 85 years that such a prolonged drought has taken place in the basin. This prolonged drought in the result of multiplicity of causes, which are discussed below: -

- (i) **Population Explosion**

At the outset there has been an explosive population growth in the Udaipur basin (Table-2). An analysis of the population growth of the past 80 years (1921-2001) shows that population increased from 34,798 in 1921 to 490142 in 2001, the year in which last census was held. Thus population has increased by 1308% over 1921. The decennial growth rate of population also shows an unprecedented growth trend. For example between 1921-1951 the decennial growth increased from +4.69 to +50.25%. Thereafter it declined to 24.01% and again increased to +45.11% between 1961-71. It reached a peak level increase of 59.30% between 1991-2001.

Table –2 Decenial Growth of Population in Udaipur City (1921-2001)


Year	Population	variation during 1921-2001 in	
		Persons	Percentage
1921	34789	+1560	+4.69
1931	44035	+9246	+26.58
1941	59648	+15613	+35.46
1951	89621	+29973	+50.25
1961	111139	+21518	+24.01
1971	161278	+50139	+45.11
1981	232588	+71310	+44.21
1991	307682	+75094	+32.28
2001	490142	+182460	+59.30

Source: Collectorate, Statistical section, Udaipur census, 2001.

This explosive growth of population has increased the demand for water causing severe depletion of both surface and underground water resources. From the statistics of water consumption requirement it is inferred that per capita water requirement for domestic purposes is 135 liters per day currently. At this rate the total water required for domestic purposes would be 27.10 million cubic meters in 2005. Another 9 million cubic meters would be required for industrial purposes totaling to 36 cubic million meters or 1271 million cubic feet water. As against it only 997 million cubic feet of water is available from all sources thus causing a deficiency of water.


(ii) Depletion of forests

Another reason for the prolonged drought is the depletion of the environment of Udaipur basin. Forests have been recklessly destroyed from the catchment area of the lakes. In the past 45 years between 1960-2004 almost 60% forest cover has been removed from the surrounding Aravalli hill ranges which now bear a deserted look. This is clearly visible from the visual interpretation of the satellite image of 1975, 1996 and 2004 (Figs. 3, 4 & 5). This has resulted in the decline of the rate of evapotranspiration and increased soil erosion.

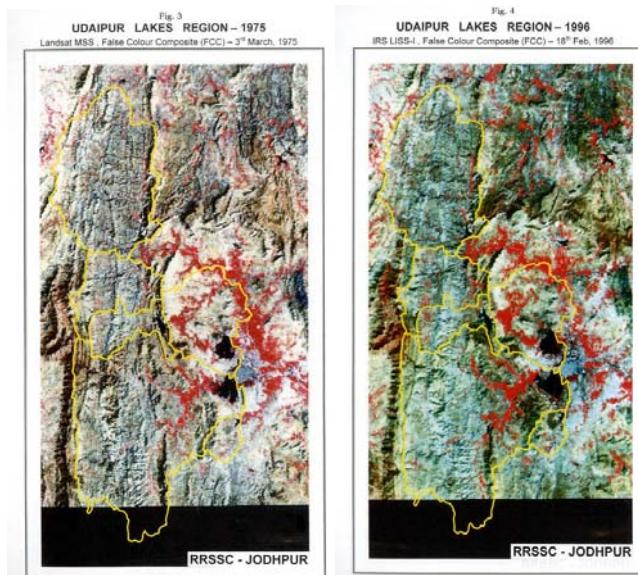

(iii) Urbanization

Rapid growth of population in the last 50 years has led to a rapid expansion of urbanization in the basin. The extent of urbanization can be gauged from the fact that the municipal limit of Udaipur city has been revised six times between 1948 and 2001. The area has increased from 17.75 km² in 1948 to 61.10 km² in 1991, an increase by 248%. It has further increased to 91.52 km² in 2001 an increase by another 50% in mere 10 years. The expansion of urban area is clearly reflected in the IRS P6 LISS satellite image of February 2004 (Fig. 5). This has led to a severe encroachment of the catchment and lake bed region. Excessive dumping of the urban waste has converted River Ahar into a dirty ditch at many places along its course prominent examples of such encroachment are at Roopsagar Tank, Naila Talab, Fateh Sagar, Picchola, Kalaliya Talab, Titardi, Madar Basin etc.

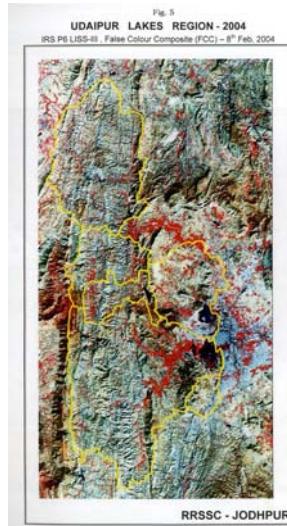

(iv) Erratic Rainfall

Udaipur basin lies in the Semi Arid Zone. It receives moderate rainfall averaging 65 cms annually. Bulk of it (95%) is received from the Southwest Monsoons from June to September. Some rainfall is also received during winters under the impact of western disturbances, however the amount received is negligible. Rainfall here is characterized by high variability and erratic occurrence. If we analyse the annual rainfall data for the past 85 years from 1921 to 2005. It will be seen that 53 years recorded below normal rainfall and only 32 years recorded normal or above rainfall. Within these 53 years of deficient rainfall continuous drought for 3-year period has been a common feature. It has occurred 8 times in the past 85 years, besides there have been two 4- year period droughts and the last six years from 1999-2004 has been the longest period of drought in the last 85 years. In the last 15 years between 1991-2005 aridity in the region has increased the percentage of rainfall deficient years has increased by 2% from 60% to 62% and the rainfall surplus years has declined by 2% from 40% to 38% (Table-3).

Table-3 Udaipur City - Annual variation of Rainfall 1921-2005

Variation categories in %	Number of years in		
	Surplus rain	Deficient rain	Total
Less than 10%	6	16	22
10 - 20	7	12	19
20 - 30	6	8	14
More than 30%	13	17	30
Total	32 (38%)	53 (62%)	85 (100%)

Source : Irrigation Department, Udaipur

(v) Expansion of Agricultural Area

Agriculture is an important activity in the Udaipur Basin. There are many valleys and some flat areas in the lakes catchment area which are being intensively used for cultivation. Over the years there has been a rapid expansion in the cultivated area in the catchment area as given in the table-4


Table-4 Udaipur Basin, Cropped Area in Lake Catchment Region

S. No	Catchment Name	Cropped area (Area in hectares)					
		Catchment area	Topo Map Crop area (1959-60)	Based on satellite data			
				3rd March, 1975	18th Feb., 1996	8th Feb., 2004	8th Feb., 2004
1	Bara Madar	8780.48	335.00	397.37	608.67	509.76	
2	Chhota Madar	2987.23	205.20	117.74	293.30	276.48	
3	Fateh Sagar	4325.35	841.80	1187.39	1279.90	631.07	
4	Bari ka Talab	1906.55	117.70	43.63	124.05	204.88	
5	Pichhola	14610.63	1283.90	1102.76	1604.73	1480.84	
6	Goverdnan Sagar	814.63	97.60	38.90	70.43	31.33	
	Total area	33424.87	2881.20	2887.79	3981.08	3134.36	

Source : Based on Indian Topographical Maps & Satellite data, RRSSC, Jodhpur

The total cropped area in the lake catchment region in 1959-60 was 2881.20 hectares, which was 8.6% of the total catchment area. It increased to 2887.79 hectares in 1975, 3981.08 hectares in February, 1996 but declined to 3134.36 hectares in February, 2004 as revealed by the satellite data. Thus in a period of 36 years the cropped area increased to peak a level of 3981.08 hectares, an increase by 38.17 percent in 1996 over 1959-60, but declined to 3134.36 hectares in February, 2004 which was however still 8.7 percent higher than the cropped area in 1959-60. An analysis of the cropped area in the individual catchment area of different lakes also clearly reveals the trend of expanding cropped area for example in case of Bara Madar the cropped area increased from 335 hectares in 1959-60 to a peak level of 608 hectares in 1996 an increase by 81% over 1959-60. In February 2004 it declined to 509 hectares which was still 51% more than the cropped area in 1959-60. Similarly in the catchment area of Pichhola the largest lake of Udaipur city the cropped area increased from 1283.9 hectares in 1959-60 to a peak level of 1604.73 hectares in February, 1996 which was 25% more than the cropped area in 1959-60. In February 2004 through it declined to 1480 hectares but it was still 15.35% higher than the cropped area in 1959-60. The catchment of Fatehsagar also shows the same trend in 1959-60 the cropped area was 841 hectares, which increased to a peak of 1279.90 hectares in 1996, an increase by 52.04% over 1959-60.

An important feature of the cultivation has been the rapid expansion of cultivated area in the lake bed region as revealed by the satellite imageries of the cropped area in the catchment of Fatehsagar and Pichhola, the two principal lakes of Udaipur city in the year 2002, 2003 and 2004 (Figs. 6,7 & 8). The dry beds of the lakes and rivers have been used for intense cultivation that exhibits an excellent example of dry land farming rapid. This expansion of seasonal farming in and around the lake bed regions has however also caused adverse impact on the underground water and has also disturbed the surface symmetry.

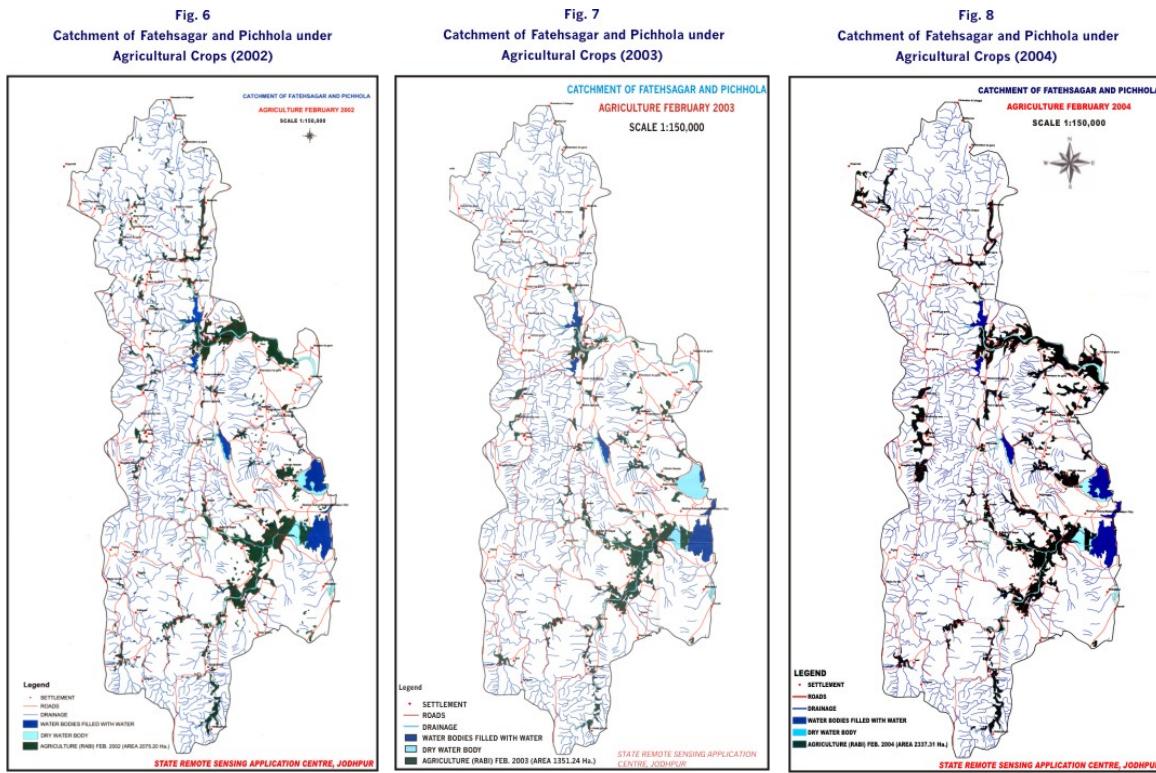

(vi) **Construction of Anicuts and Check Dams**

Construction of anicuts and check dams across the major feeder drainage channels at several places has interrupted the free flow of rain water into the lakes. Consequently the lakes do not receive sufficient water from their catchment areas. Presently there are 53 anicuts built across these channels of which 23 are more than 2 meters high.

CONCLUSION

From the above discussion it is amply clear that the problem of drying of lakes is an acute problem which needs careful planning and water conservation measures. The lakes of Udaipur basin are an engineering marvel, which were constructed at the time when modern scientific techniques for the construction of the reservoirs were not available. Inspite of this, under the proper guidance and far sightedness of erstwhile rulers of Mewar led by Maharana Lakha, some of the most amazing and artistic pieces of engineering took their shape in the form of Pichhola, Duh Talai, Kalaliya Talab, Rangsagar, Swaroopsagar, Fatehsagar, Udaisagar, Rajsamand and Jaisamand lakes. These lakes are unique as creation of man's interference with and modification of the natural drainage system. These should be declared World Heritage.

Steps need to be taken to find a permanent solution to save these lakes. For this new linkages connecting these lakes with distant water bodies need to be developed which include Mansi, Wakal, Dewas and Mahi. In this regard the approach adopted by the erstwhile rulers of Mewar need to be adopted. If we look at the construction, design and location of the lakes they are so built and connected that when one lake gets filled the water is automatically released to the other lake thus maintaining water balance in different lakes. Also wasteful consumption needs to be avoided. Construction of anicuts across the drainage channels needs to be limited and encroachment of the lakebeds needs to be controlled.

ACKNOWLEDGEMENTS

The author is grateful to Dr. J.R. Sharma, Director Regional Remote Sensing Service Center, ISRO- DOS Jodhpur for providing remotely sensed data to carry out this study. My sincere appreciation and thanks to Mr. Ajay Kumar Garg Executive Engineer, Department of Irrigation, Udaipur for active cooperation and providing the required information and data. I am also thankful to my research scholar Mr. Narendra Verma for helping me at every stage of this research study.

REFERENCES:

- Addison, N. (1955). Land, Vjater and Food, Chapman and Hall Ltd., London.
- Census of India, 1961 (1971). 1981, 1991, 2001 district census hands book, Udaipur district publishing census operations, Jaipur.
- Choondawat, Samiksha, (2005). Assessment of Natural Resources and Environmental Degradation in Udaipur basin, Ph.D. thesis, Dept. of Geography, faculty of Social Sciences, M.L.Sukhadia University, Udaipur (Raj.) India.
- GIS, (2000). Atlas of Rajasthan, Geology and Minerals, Geological Survey of India, Jaipur (Raj.) India.
- Jain D.K. & Others, (2002). District Statistics outline, 2002. District Udaipur, Economic and Statistical Directorate, Rajasthan, Jaipur, India
- Mittal, S., Agarwal, M., (2004). Environment and Environmental Education in 21st Century, Navchetana Publications, Jaipur (Raj.) India.
- Rajasthan Government, (19970. Discover Rajasthan, Department Tourism, Art & Culture, Govt. of Rajasthan, Jaipur (Raj.) India.
- Rajawat D.S., Sharma M.R., (1998). 'Udaipur' the city of lakes, Delta Publication, Jaipur India.
- Rathore, N.S. (1992). Natural Resources Base Development Scientific Publishers, Jodhpur (Raj.) India.
- Rathore, N.S. (2002). Deforestation in Great Aravalli Mountain region of India. Proceeding of the 23rd Asian Conference on Remote Sensing, Survey Dept. Kathmandu, Nepal.
- Ray, U.P., (2005). People's participation in Watershed Management Kanishka Publishers, New Delhi.
- Sharma, P.D., (2004). Ecology and Environment. Rastogi Publication, Meerut (U.P.) India.
- Singh, R.N. (1971). India Regional Geography (edited), National Geographical society of India, Varanasi, UBS Publication, New Delhi.
- Udaipur, (1995). Udaipur, Rajasthan Tourism, Paryatan Bhawan, Govt. Hoster Campus, Jaipur (Raj.) India.